

---

# Ford Five Hundred Throttle Body Relearn

---

*Ford Five Hundred  
Throttle Body Relearn*

*Downloaded from  
[db.whlcarchitecture.com](http://db.whlcarchitecture.com)  
by Jaylin & Madden*

---

## UNDERSTANDING THE FORD FIVE HUNDRED THROTTLE BODY RELEARN PROCEDURE

---

The Ford Five Hundred, a full-size sedan produced from 2004 to 2007, is known for its comfortable ride, spacious interior, and reliable 3.0L Duratec V6 engine. However, like many modern vehicles with drive-by-wire throttle systems, it

sometimes requires a throttle body relearn procedure after certain maintenance tasks. Whether you have just cleaned the throttle body, replaced it, disconnected the battery, or experienced a dead battery, performing a correct Ford Five Hundred throttle body relearn is essential to restore smooth idle, proper throttle response, and overall drivability. Without this relearn, the engine may idle rough, hesitate on acceleration, or even trigger

a check engine light. In this comprehensive guide, we will walk you through everything you need to know about the throttle body relearn on the Ford Five Hundred, including symptoms that indicate a relearn is needed, step-by-step procedures, and troubleshooting tips.

---

## **WHAT IS A THROTTLE BODY RELEARN?**

---

A throttle body relearn (also known as throttle body recalibration or idle relearn) is a process by which the vehicle's powertrain control module (PCM) resets and adapts to the current position of the throttle plate. On a Ford Five Hundred, the electronic throttle control (ETC) system relies on sensors to determine the exact angle of the throttle

blade. When you disconnect the battery, clean the throttle body, or replace any part of the air intake system, the PCM loses its learned adaptive values. The relearn procedure teaches the PCM the closed throttle position (idle) and the full range of motion, ensuring accurate fuel and air mixture control. Skipping this step can lead to erratic idle speeds, stalling, poor fuel economy, or a persistent diagnostic trouble code (DTC) such as P2101 or P2110.

---

## **SYMPTOMS THAT INDICATE THE NEED FOR A THROTTLE BODY RELEARN**

---

Not every rough idle or hesitation means your Ford Five Hundred needs a throttle body relearn. However, if you have recently performed any of the following

actions, experiencing these symptoms strongly suggests a relearn is necessary:

- **Rough or fluctuating idle:** The engine hunts between 500 and 1200 rpm, or stalls when coming to a stop.
- **Hesitation or stumble on acceleration:** Pressing the gas pedal results in a delayed or jerky response.
- **Check engine light illuminated:** Codes such as P0505 (idle control system), P2101 (throttle actuator control motor circuit range/performance), or P2110 (throttle actuator control system – forced limited rpm) may appear.
- **Reduced power mode (limp mode):** The car limits speed and

throttle response to protect the engine.

- **High idle speed:** Engine remains above normal idle (around 1000 rpm or more) even when warm.
- **Poor fuel economy:** The PCM is unable to correct air-fuel mixture without proper throttle position adaptation.

If you have replaced the throttle body, cleaned it, disconnected the battery for more than a few minutes, or replaced the PCM, performing a Ford Five Hundred throttle body relearn should be your first step before further diagnostics.

---

## ROOT CAUSES OF NEEDING A RELEARN

---

Understanding why the PCM loses its

memory helps you prevent unnecessary relearns in the future. The main causes include:

1. **Battery disconnect or dead battery:** The PCM relies on constant power to retain adaptive learning. A complete power loss resets these values.
2. **Throttle body cleaning:** Using a throttle body cleaner removes carbon deposits, but also changes the physical stop position of the throttle plate slightly (cleaner plate rests differently).
3. **Throttle body replacement:** A new throttle body has different mechanical tolerances; the PCM must learn its specific closed position.

4. **PCM replacement or reprogramming:** Any PCM software update or replacement clears all adaptive memory.
5. **Air intake system modifications:** Aftermarket cold air intakes or changes to the intake tube can alter airflow characteristics, requiring a relearn.

---

## PRECAUTIONS BEFORE PERFORMING THE RELEARN

---

Before starting any throttle body relearn procedure on your Ford Five Hundred, take these safety and preparation steps:

- Ensure the battery is fully charged (12.6 volts or more) – low voltage can cause the relearn to fail.
- Make sure the engine is at normal

operating temperature (approximately 190–210°F).

- Turn off all electrical loads: headlights, air conditioning, radio, interior lights, and any accessories.
- Park the vehicle on a level surface with the parking brake applied.
- Do not touch the accelerator pedal during the relearn unless the procedure explicitly instructs you to do so.
- If you have performed throttle body cleaning, allow the cleaner to fully evaporate before starting the engine.

---

## HOW TO PERFORM A FORD FIVE HUNDRED THROTTLE BODY

### RELEARN - THE PEDAL METHOD

---

The most common procedure for the Ford Five Hundred (and many other Ford and Mazda-based vehicles) is the so-called “pedal method.” This is an adaptive idle relearn that can be done without a scan tool. Follow these steps exactly:

1. **Initial Setup:** Ensure the vehicle is in Park (automatic) or Neutral (manual). Turn the ignition to the OFF position and wait at least 10 seconds.
2. **Key On, Engine Off:** Turn the ignition key to the ON position (engine not running). Do not start the engine. Wait for 3 seconds.
3. **Depress and Release Accelerator:** Within the next 5 to

10 seconds, press the accelerator pedal fully to the floor (wide open throttle) and then release it completely. Do this quickly – the entire action should take less than 1 second.

4. **Return to Off:** Turn the ignition key back to OFF. Wait at least 10 seconds.
5. **Start the Engine:** Start the engine and let it idle without touching the gas pedal. Do not rev the engine or drive the car for at least 5 to 10 minutes. The PCM will be learning the idle position during this time. The idle may be erratic initially but should stabilize.
6. **Test Drive:** After the idle has stabilized (usually 10 minutes of idling or a short drive), take the

car for a gentle test drive.

Accelerate gradually through various speeds, and allow the engine to decelerate without braking heavily. This helps the PCM learn the full range of throttle positions.

Some Ford Five Hundred models may require a slight variation: after the key-on step, some owners report that you must depress and release the accelerator pedal exactly 5 times within a 10-second window. Experimentation may be needed, but the standard method above works for most versions. If the idle remains unstable, repeat the entire sequence.

---

## ALTERNATIVE RELEARN METHOD

### USING A SCAN TOOL

If the pedal method fails or you have access to an OBD-II scan tool with bidirectional control (such as a Snap-on, Autel, or Ford IDS), you can perform a forced throttle body relearn more reliably. The exact menu items vary by tool, but the general steps are:

1. Connect the scan tool to the OBD-II port and turn the ignition on (engine off).
2. Navigate to the “Throttle Relearn” or “Idle Relearn” function under the PCM or Powertrain menu.
3. Follow the on-screen prompts. Usually, the tool will command the throttle plate to move to its closed

position, then move it to the open position, and then store these values.

4. After completion, start the engine and allow it to idle for 10 minutes with all accessories off.
5. Clear any diagnostic trouble codes if they remain.

Using a scan tool is especially helpful if the throttle body was replaced, as the PCM may not enter relearn mode via the pedal method if certain conditions (e.g., throttle position sensor mismatch) are present.

### COMMON ISSUES DURING THE RELEARN AND HOW TO FIX THEM

Even if you follow the steps precisely, sometimes the Ford Five Hundred throttle body relearn does not take. Here

are common pitfalls:

- **Incorrect timing:** The pedal must be depressed and released within a specific window after key-on. If you are too slow, the PCM may ignore the command. Try again with quicker action.
- **Dirty throttle body:** If the throttle body is heavily carboned, the plate may not return to its true closed position. Cleaning it properly before the relearn is critical.
- **Vacuum leaks:** A leak in the intake system (cracked hose, bad gasket) can cause unstable idle that prevents the PCM from completing the learn cycle. Inspect for vacuum leaks using a smoke

machine or propane test.

- **Weak battery or alternator:**  
Low voltage during the relearn can corrupt the learning process. Charge the battery or replace it if needed.
- **Aftermarket PCM or tune:**  
Modified software may ignore factory relearn procedures. Consult your tuner for specific instructions.
- **Throttle position sensor (TPS) fault:** If the TPS is failing or has a narrow voltage range, the PCM cannot learn the idle position. Check TPS voltage at idle (should be around 0.8–1.2 volts) and at wide open throttle (around 4.5 volts).



---

## **THE IMPORTANCE OF THE THROTTLE BODY RELEARN FOR PERFORMANCE AND LONGEVITY**

---

Skipping the Ford Five Hundred throttle body relearn after battery disconnection or throttle cleaning is a common mistake that leads to avoidable drivability complaints. Beyond the immediate symptoms, a failed relearn can cause the PCM to compensate incorrectly, leading to rich or lean fuel trims, increased carbon buildup, and premature wear on the throttle control motor. Additionally, the ETC system on the Five Hundred is sensitive: prolonged use without proper adaptation can result in the PCM storing a hard fault that might require a dealer visit to reset. By taking just a few minutes to perform the

relearn, you ensure that the engine management system operates at its peak efficiency, preserving fuel economy and drivability.

---

## **RELATED ADAPTATIONS: IDLE AIR CONTROL AND TRANSMISSION RELEARN**

---

While this article focuses on the throttle body, note that the Ford Five Hundred also has adaptive strategies for idle air control (though many late-model Fords use the electronic throttle for idle control – no separate idle air control valve). Additionally, if you have disconnected the battery, the transmission (if automatic) may also need to relearn shift patterns. This happens naturally during driving, but you may notice harsh shifts initially. The throttle body relearn

does not directly affect the transmission, but a stable idle and throttle response do improve overall driving comfort.

---

## CONCLUSION

---

Mastering the Ford Five Hundred throttle body relearn is an essential skill for any owner or technician working on this vehicle. Whether you are cleaning the throttle body as part of routine maintenance or replacing it due to a fault, following the correct procedure ensures that the PCM and electronic throttle control work in harmony. The

pedal method is a quick, tool-free solution that works in most cases, while a scan tool offers a more definitive reset for stubborn situations. Always begin with a fully charged battery, a clean throttle body, and no vacuum leaks. If you encounter persistent issues after repeated attempts, have the system inspected for mechanical faults or sensor failures. With a proper throttle body relearn, your Ford Five Hundred will idle smoothly, accelerate responsively, and deliver the reliable performance it was designed to provide.